



# CENTURION 100

**BPL**  
BRIGHT PATH LIGHTING, INC.  
1-877-343-7300



**Centurion 100 is UL 924 Listed for indoor/outdoor wet location use.**



Lights off

**Viewing Distance of 100'**

**NO FRAME NEEDED**

**15 Year Limited Warranty**



**Field Applied Chevrons**

- Non-electric
- Non-radioactive
- Non-hazardous
- No expiration date
- Energy efficient
- LEED points qualified
- Zero annual operating expense
- No batteries
- No bulbs
- Low maintenance
- 100% reliable
- High or low level
- Simple installation
- 25+ year life expectancy

**Available Colors**




*The Centurion 100 Series photoluminescent exit sign is constructed out of injection molded ABS for ultimate durability. Ideal for high location and floor proximity use. Easy self adhesive directional chevrons included. UL 924 Listed for wet location and four external charging light sources: unfiltered fluorescent, metal-halide, LED, and mercury vapor. UL Listed for indoor and outdoor use.*

# specifications


## Mounting Options Surface • Ceiling • Flag • T-Bar

Dimensions:	9.5" H, 17.25" W, 13/64" Thickness
Letter Size:	1" Stroke with 8" Height
Letter Color:	Photoluminescent
Background:	Black, Green, or Red
Construction:	Injection molded ABS
Directional:	Two self adhesive photoluminescent directional chevrons included for field application.
Viewing Distance:	100 Feet - Sign will remain visible and legible in total darkness to observers standing 100 feet away from the sign for at least 90 minutes after all light has been extinguished.
Life Expectancy:	25+ Years
Applications:	High location, floor proximity, wet location, indoor/outdoor use.
Installation:	Install photoluminescent exit signs only in locations where an external illumination source is present, is deemed reliable, and is supplied by a circuit not controlled by automatic timers or sensors, and where controls are accessible only to authorized personnel. Minimum of 5 foot-candle (54lux) external illumination of unfiltered metal halide, fluorescent, mercury vapor or LED charging light sources required on sign face at all times of building occupancy.
Charging Time:	Initial charging time is 60 minutes.
Sign Substrate:	Injection molded ABS
Features:	Non-electrical, non-radioactive, explosion proof, UV-stable, durable, minimal installation and maintenance expense, photoluminescent cast 3D raised lettering.
Approvals:	UL 924 Listed, Meets NFPA 101 Life Safety Code, JCAHO & OSHA, ICC - IBC, ICBO - UBC, BOCA - NBC, SBCCI - SBC, NFPA 101, 5000, 1/UFC, CA Bldg. Code, and ASTM 2072
Warranty:	15-year limited warranty to the original customer against defects in workmanship and materials.

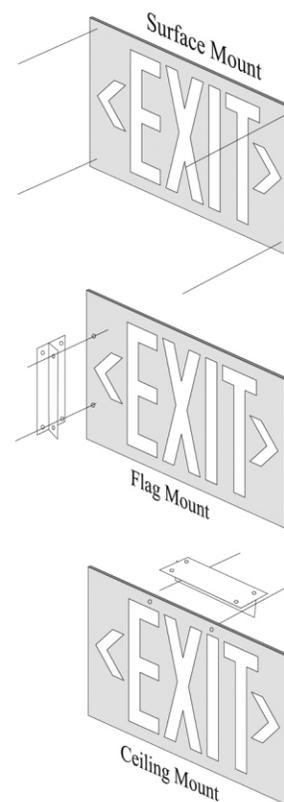

### Description

Description	Item No.'s
black, wall mount exit sign	CN100WB
black, single-sided sign w/bracket	CN100SB
black, double-sided sign w/bracket	CN100DB
black, single-sided sign w/T-bar bracket	CN100STB
black, double-sided sign w/T-bar bracket	CN100DTB
red, wall mount exit sign	CN100WR
red, single-sided sign w/bracket	CN100SR
red, double-sided sign w/bracket	CN100DR
red, single-sided sign w/T-bar bracket	CN100STR
red, double-sided sign w/T-bar bracket	CN100DTR
green, wall mount exit sign	CN100WG
green, single-sided sign w/bracket	CN100SG
green, double-sided sign w/bracket	CN100DG
green, single-sided sign w/T-bar bracket	CN100STG
green, double-sided sign w/T-bar bracket	CN100DTG

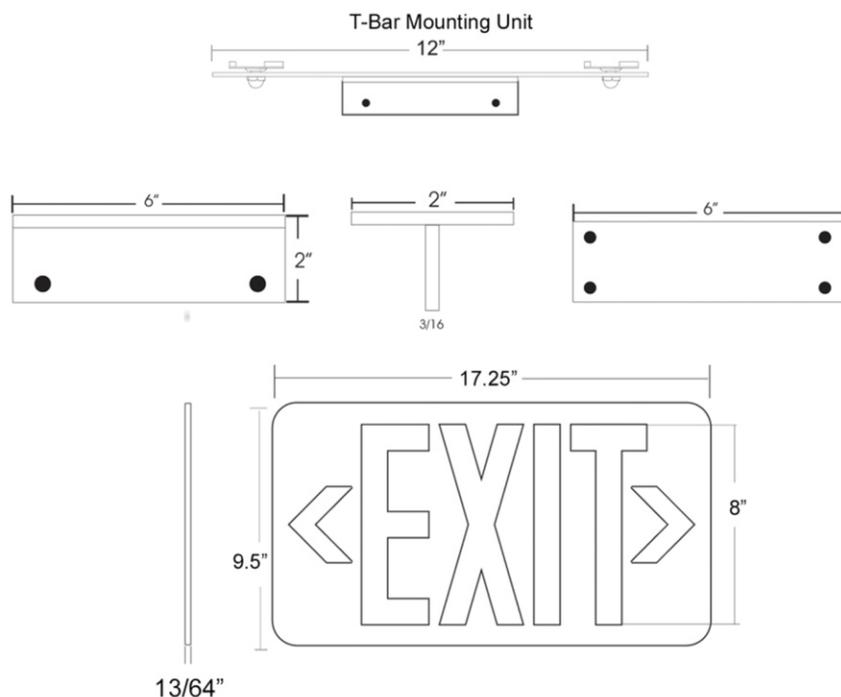



Ph. 559.443.7300  
877.343.7300  
Fax. 559.443.7393  
2910 E. Heaton Ave., Ste. B  
Fresno, Ca 93721

---

**IMPORTANT SAFEGUARDS  
READ AND FOLLOW ALL SAFETY INSTRUCTIONS**

---

**BPL CENTURION UL 924 Listed Photoluminescent EXIT Sign**

**CAUTION  
EXTERNAL ILLUMINATION SOURCE REQUIRED**

**ACTIVATION**

**Minimum 5-foot candles (54 lux) of unfiltered fluorescent, metal halide or mercury vapor lighting.**

- Install BPL CENTURION Photoluminescent EXIT signs only in locations where an external illumination source is present, is deemed reliable and is supplied by a circuit not controlled by automatic timers or sensors, and whose controls are accessible only to authorized personnel. This reliable external illumination source is to be energized at all times during building occupancy.
- BPL CENTURION Photoluminescent EXIT signs are for **INDOOR** use only. Do not expose to direct sunlight, liquid spray or temperature outside the range 10°C – 40°C (50° – 104°F).
- Check with your applicable installation codes (such as NFPA 101 – Life Safety Code) to perform periodic visibility tests.
- Should any changes in your external lighting types or lighting levels occur, make sure that the BPL CENTURION exit sign is still being illuminated with minimum 5-foot candles (54 lux) of unfiltered fluorescent, metal halide or mercury vapor lighting.
- Periodically clean sign face with a damp cloth. Do not use any thinners or solvents on the sign face.

**VIEWING DISTANCE  
100 foot viewing distance**

**DIRECTIONAL INDICATORS**

Two self-adhesive directional indicators are supplied with each sign. Small dots are also provided to the left of the letter E and to the right of the letter T for easy alignment. If your EXIT sign is to be located other than directly over an exit, apply a directional indicator to the left of the E, pointing left, or to the right of the T, pointing right, or both, as appropriate.

**- SAVE THESE INSTRUCTIONS -**



Ph. 559.443.7300  
877.343.7300  
Fax. 559.443.7393  
2910 E. Heaton Ave., Ste. B  
Fresno, Ca 93721

**Flush Mount**  
**Mounting of CENTURION EXIT Sign to Surface**

1. Place the EXIT Sign in position and mark the screw hole locations.
2. If wall anchors will be required, drill 4ea 3/16" holes and install them at this time (Supplied).
3. Attach the CENTURION EXIT Sign to the wall by using the two supplied #8 Phillips head screws. Be careful not to over tighten the screws.
4. If directional arrows are to be used, apply them to the EXIT Sign at this time.
  - a. Alignment dots are provided on the face of the sign to ensure proper positioning of the arrows.
    - i. For Exit paths straight ahead, no arrows are needed.
    - ii. For Exit paths to the left, apply the arrow on the left side of the EXIT Sign.
    - iii. For Exit paths to the right, apply the arrow on the right side of the Exit Sign.
    - iv. If Exit paths are located to the left and right, apply both arrows to the EXIT Sign.

**Flag or Ceiling or T-Bar Mount**  
**Installation Instructions for the CENTURION EXIT Sign**

1. If directional arrows are to be used, apply them to the EXIT Sign at this time.
  - a. Alignment dots are provided on the face of the sign to ensure proper positioning of the arrows.
    - i. For Exit paths straight ahead, no arrows are needed.
    - ii. For Exit paths to the left, apply the arrow on the left side of the EXIT Sign.
    - iii. For Exit paths to the right, apply the arrow on the right side of the Exit Sign.
    - iv. If Exit paths are located to the left and right, apply both arrows to the EXIT Sign.

**FOR FLAG MOUNT**

2. Place the EXIT Sign **bracket** in position and mark the screw hole locations.
3. If wall anchors will be required, drill 4ea 3/16" holes and install them at this time (Supplied).
4. Attach the EXIT Sign **Bracket** to the wall using the supplied #6 screws and anchors.
5. Drill two 3/32" holes in the sign face where indicated by the alignment dots near the end of the sign.
6. Slide the mounting bracket onto the side of the exit sign and align with the drilled holes.
7. Attach the CENTURION EXIT sign to the bracket and secure into place by inserting the screws and tightening the acorn nuts which are supplied with the sign.

**FOR CEILING MOUNT**

2. Place the EXIT Sign **bracket** in position and mark the screw hole locations.
3. If wall anchors will be required, drill 4ea 3/16" holes and install them at this time (Supplied).
4. Attach the exit sign Bracket to the ceiling using the supplied #6 screws and anchors.
5. Drill two 3/32" holes in the sign face where indicated by the alignment dots near the top of the sign.
6. Slide the mounting bracket onto the top of the exit sign and align with the drilled holes.
7. Attach the CENTURION EXIT sign to the bracket and secure into place by inserting the screws and tightening the acorn nuts which are supplied with the sign.

**FOR T-BAR MOUNT**

2. Place the EXIT Sign **bracket** in position and attach using the supplied T-Bar clips.
3. Slide the mounting bracket onto the top exit sign and align with the pre-drilled holes.
4. Attach the CENTURION EXIT sign to the bracket and secure into place by inserting the screws and tightening the acorn nuts which are supplied with the sign.

- SAVE THESE INSTRUCTIONS -